

ex trees retained

ex entrance concrete replaced with planting/pebbles

ex access gate impedes pathway

concrete path

ex concrete path

64' run = 8 panels

new ground cover planting to accommodate level change

REC CENTER

ex concrete pool surround repaired as required

existing planting beds retained and enlarged

lighting post upgraded and/or relocated

72' run = 9 panels

fence to be 7' high over this run to accommodate entrance gate transom; gate posts 3'6" c/c; 3 equal w/o panels; approx 22 lin ft o/a

pool equipment relocated as reqd

new bed

ex parking bays and pathways retained

bike racks

new pool entrance path laid to berm contour

ex grassy knoll retained

ex grass replaced with hard surfacing redundant irrigation installation removed

80' run = 10 panels

line of mowing strip

service access gate


new fence installed in 16" wide pebble drainage bed by landscaper

Key

existing 6' high chain link fence, top rail, posts at 8' c/c, concrete, 265 lin ft o/a

new fence as spec; 6' high; 7' high at entrance run; posts at 8' c/c; self-latching gate; 238 approx lin ft o/a constant straight top to all runs

ex trees retained

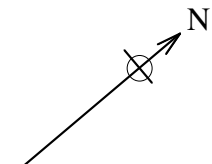

HARTUNG HOA POOL & FENCE REVIEW

General Layout
June 2018

SK 01